

FORM 100 USE PREVIOUS EDITIONS

CLASSIFIED MESSAGE

ROUTING

~~SECRET~~

1	9
2	10
3	11
4	12
5	13
6	14
7	15
8	16

16.14

TO :

FROM :

ACTION:

INFO :

IN-50453

OPS 1-10-72

25X1A6c ~~SECRET~~ 171923Z CITE [REDACTED] 9491
 25X1A6c [REDACTED] INFO [REDACTED]
 25X1A6c [REDACTED]
 25X1A29 IDEALIST [REDACTED]

CITE

- A. 3387A
- B. 381
- C. 14 JAN 67, 4 PLUS 45
- D. HI [REDACTED] TEST
- E. (1) EXCESSIVE NOISE FROM DEFROSTER AND DEFROSTER WOULD NOT

TURN OFF COMPLETELY WITH KNOB COMPLETELY IN

C/A - JAM NUT WAS LOOSE ON CONTROL KNOB. ADJUSTED SO WOULD SHUT OFF

(2) SLAVE GYRO HAD FLUCTUATION UP TO 60 DEGREES FOR APPROX 4 MINUTES AFTER TAKE-OFF

C/A - SP-139122-31 GYRO PLATFORM REPLACED, S/N OUT 421. S/N IN 467

(3) DRIFTSIGHT DOES NOT TRACK STRAIGHT AHEAD AND DOES NOT ALIGN DIRECTLY BETWEEN PITOT TUBES

C/A - DRIFTSIGHT ADJUSTED TO TRACK STRAIGHT AND ALIGN BETWEEN PITOT TUBES

~~SECRET~~ TOR: 171938Z JAN 67

~~SECRET~~

GROUP 3
EXCLUDED FROM AUTO-
MATIC DOWNGRADING
AND DECLASSIFICATION